# **User's Manual**

For

# A088M

# **High Performance Microstepping Drive**

Version 1.0 ©2009 All Rights Reserved

Attention: Please read this manual carefully before using the Drive!





3/F, Block 2, Nanyou Tianan Industrial Park, Nanshan Dist, Shenzhen, China

T: (86)755-26434369 F: (86)755-26402718

 The content in this manual has been carefully prepared and is believed to be accurate, but no responsibility is assumed for inaccuracies.

Leadshine reserves the right to make changes without further notice to any products herein to improve reliability, function or design. Leadshine does not assume any liability arising out of the application or use of any product or circuit described herein; neither does it convey any license under its patent rights of others.

Leadshine's general policy does not recommend the use of its products in life support or aircraft applications wherein a failure or malfunction of the product may directly threaten life or injury. According to Leadshine's terms and conditions of sales, the user of Leadshine's products in life support or aircraft applications assumes all risks of such use and indemnifies Leadshine against all damages.

©2009 by Leadshine Technology Company Limited.
All Rights Reserved

# Contents

# Contents

T	ah	Ι۵	Ωf	Co	nte	nts
	10		OI.	$\mathbf{v}$		1163

1. Introduction, Features and Applications	. 1
Introduction	. 1
Features	. 1
Applications	. 1
2. Specifications	. 1
Electrical Specifications	. 1
Operating Environment and other Specifications	. 2
Mechanical Specifications	. 2
Elimination of Heat	. 2
3. Pin Assignment and Description	. 3
Connector P1 Configurations	. 3
Selecting Effective Pulse Edge or Effective Level and Control Signal Mode	. 4
Connector P2 Configurations	. 4
4. Control Signal Connector (P1) Interface	. 4
5. Connecting the Motor	. 5
Connections to 4-lead Motors	. 5
Connections to 6-lead Motors	. 6
Half Coil Configurations	. 6
Full Coil Configurations	. 6
Connections to 8-lead Motors	. 7
Series Connections	. 7
Parallel Connections	. 7
6. Power Supply Selection	. 7
Regulated or Unregulated Power Supply	. 8
Multiple Drives	. 8
Selecting Supply Voltage	. 8
7. Selecting Microstep Resolution and Drive Output Current	. 8
Microstep Resolution Selection	. 9
Current Settings	. 9

Dynamic current setting
Standstill current setting
8. Wiring Notes10
9. Typical Connection
10. Sequence Chart of Control Signals
11. Protection Functions 12
Short-voltage and Over-voltage protection
Over-current Protection 12
Short Circuit Protection
12. Frequently Asked Questions
Problem Symptoms and Possible Causes
APPENDIX 13
Twelve Month Limited Warranty
Exclusions
Obtaining Warranty Service
Warranty Limitations
Contact Us



# 1. Introduction, Features and Applications

#### Introduction

The M880A is a high performance microstepping Drive based on pure-sinusoidal current control technology. Owing to the above technology and the self-adjustment technology (self-adjust current control parameters) according to different motors, the driven motors can run with smaller noise, lower heating, smoother movement and have better performances at higher speed than most of the Drives in the markets. It is suitable for driving 2-phase and 4-phase hybrid stepping motors.

#### **Features**

- I High performance, cost-effective
- I Supply voltage up to +72VDC
- I Output current up to 7.8A
- I Self-adjustment technology
- I Pure-sinusoidal current control technology
- I Pulse input frequency up to 300 KHz
- I TTL compatible and optically isolated input

- Automatic idle-current reduction
- I 16 selectable resolutions in decimal and binary, up to 51,200 steps/rev
- I Suitable for 2-phase and 4-phase motors
- I Support PUL/DIR and CW/CCW modes
- I Short-voltage, over-voltage, over-current and short-circuit protection

Web Site: www.leadshine.com

#### **Applications**

Suitable for a wide range of stepping motors, from NEMA size 17 to 43. It can be used in various kinds of machines, such as X-Y tables, labeling machines, laser cutters, engraving machines, pick-place devices, and so on. Particularly adapt to the applications desired with low noise, low heating, high speed and high precision.

# 2. Specifications

Tel: +086 0755-26434369

**Electrical Specifications**  $(T_i = 25 \degree C/77 \degree F)$ 

Parameters	M880A				
Parameters	Min	Typical	Max	Unit	
Output current	1.8	-	7.8 (5.6 RMS)	A	
Supply voltage	+24	+68	+72	VDC	
Logic signal current	7	10	16	mA	
Pulse input frequency	0	-	300	KHz	
Isolation resistance	500			$M\Omega$	



#### **Operating Environment and other Specifications**

Cooling	Natural Cooling or Forced cooling			
	Environment	Avoid dust, oil fog and corrosive gases		
	Ambient Temperature	$0^{\circ}\text{C} - 40^{\circ}\text{C} (32^{\circ}\text{F} - 104^{\circ}\text{F})$		
Operating Environment	Humidity	40%RH — 90%RH		
	Operating Temperature	70°C (158°F) Max		
	Vibration	$5.9 \text{m/s}^2 \text{Max}$		
Storage Temperature	-20°C - 65°C (-4°F - 149°F)			
Weight	Approx. 570g (20.10 oz)			

# Mechanical Specifications (unit: mm[inch])

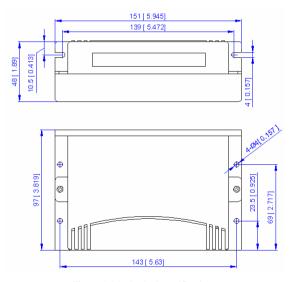


Figure 1: Mechanical specifications


#### **Elimination of Heat**

I Drive's reliable working temperature should be  $<70^{\circ}\text{C}(158^{\circ}\text{F})$ , and motor working temperature should be  $<80^{\circ}\text{C}(176^{\circ}\text{F})$ ;

Tel: +086 0755-26434369 2 Web Site: www.leadshine.com

<sup>\*</sup>Recommend use side mounting for better heat dissipation

- It is recommended to use automatic idle-current mode, namely current automatically reduce to 60% when motor stops, so as to reduce Drive heating and motor heating;
- I The Drive must be mounted vertically to maximize heat sink area as shown in the following picture. Use forced cooling method to cool the system if necessary.

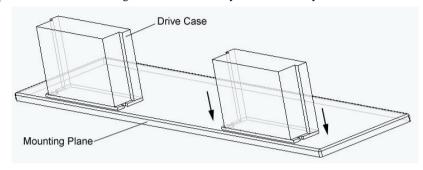

Important NOTE: The driver must be mounted vertically onto a plate or a heat sinking to maximize heat sink area as shown in the above picture. Please use additional heat sinking or cool fan if necessary.

# 3. Pin Assignment and Description

The M880A has two connectors, connector P1 for control signals connections, and connector P2 for power and motor connections. The following tables are brief descriptions of the two connectors. More detailed descriptions of the pins and related issues are presented in section 4, 5, 9.

# **Connector P1 Configurations**

 
Pin Function	Details
PUL+	<u>Pulse signal:</u> In single pulse (pulse/direction) mode, this input represents pulse signal, active at each rising or falling edge (set by inside jumper J3); 4-5V when PUL-HIGH, 0-0.5V when PUL-LOW. In double pulse mode
PUL-	(pulse/pulse), this input represents clockwise (CW) pulse, active at high level or low level (set by inside jumper J3). For reliable response, pulse width should be longer than 1.5μs. Series connect resistors for current-limiting when +12V or +24V used.



DIR+	<u>DIR signal:</u> In single-pulse mode, this signal has low/high voltage levels, representing two directions of motor rotation; in double-pulse mode (set by inside jumper J1), this signal is counter-clock (CCW) pulse, active at high level or low level (set by inside jumper J3). For reliable motion response, DIR	
DIR-	signal should be ahead of PUL signal by 5µs at least. 4-5V when DIR-HIGH, 0-0.5V when DIR-LOW. Please note that motion direction is also related to motor-Drive wiring match. Exchanging the connection of two wires for a coil to the Drive will reverse motion direction.	
ENA+	Enable signal: This signal is used for enabling/disabling the Drive. High level (NPN control signal, PNP and Differential control signals are on the contrary,	
ENA-	namely Low level for enabling.) for enabling the Drive and low level for disabling the Drive. Usually left <b>UNCONNECTED</b> ( <b>ENABLED</b> ).	

#### Selecting Effective Pulse Edge or Effective Level and Control Signal Mode

There are two jumpers J1 and J3 inside the M880A specifically for selecting active pulse edge or effective level and control signal mode, as shown in figure 2. Default setting is PUL/DIR mode and upward-rising edge active.(Note: J2 inside the Drive is used to reverse the default rotation direction.)



(c) J1 short circuit, J3 open circuit (d) J1, J3short circuit

CW/CCW mode and active at low level (The fixed level)

CW/CCW mode and active at high level (The fixed level)

Figure 2: J1 and J3 jumpers

# **Connector P2 Configurations**

Pin Function	Details		
VDC	Power supply, 24~72 VDC, Including voltage fluctuation and EMF voltage.		
GND	Power Ground.		
A+, A-	Motor Phase A		
B+, B-	Motor Phase B		

# 4. Control Signal Connector (P1) Interface

The M880A can accept differential and single-ended inputs (including open-collector and PNP output). The M880A has 3 optically isolated logic inputs which are located on connector P1 to accept

Tel: +086 0755-26434369 3 Web Site: <u>www.leadshine.com</u> Tel: +086 0755-26434369 4 Web Site: <u>www.leadshine.com</u>

line Drive control signals. These inputs are isolated to minimize or eliminate electrical noises coupled onto the drive control signals. Recommend use line Drive control signals to increase noise immunity of the Drive in interference environments. In the following figures, connections to open-collector and PNP signals are illustrated.

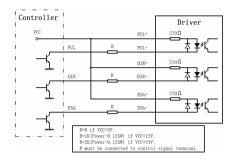


Figure 3: Connections to open-collector signal (common-anode)

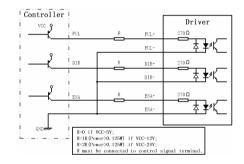


Figure 4: Connection to PNP signal (common-cathode)

# 5. Connecting the Motor

The M880A can drive any 2-pahse and 4-pahse hybrid stepping motors.

#### **Connections to 4-lead Motors**

4 lead motors are the least flexible but easiest to wire. Speed and torque will depend on winding inductance. In setting the Drive output current, multiply the specified phase current by 1.4 to determine the peak output current.



 


Figure 5: 4-lead Motor Connections

#### **Connections to 6-lead Motors**

Like 8 lead stepping motors, 6 lead motors have two configurations available for high speed or high torque operation. The higher speed configuration, or half coil, is so described because it uses one half of the motor's inductor windings. The higher torque configuration, or full coil, uses the full windings of the phases.

#### **Half Coil Configurations**

As previously stated, the half coil configuration uses 50% of the motor phase windings. This gives lower inductance, hence, lower torque output. Like the parallel connection of 8 lead motor, the torque output will be more stable at higher speeds. This configuration is also referred to as half chopper. In setting the Drive output current multiply the specified per phase (or unipolar) current rating by 1.4 to determine the peak output current.



Figure 6: 6-lead motor half coil (higher speed) connections

#### **Full Coil Configurations**

The full coil configuration on a six lead motor should be used in applications where higher torque at lower speeds is desired. This configuration is also referred to as full copper. In full coil mode, the motors should be run at only 70% of their rated current to prevent over heating.



Figure 7: 6-lead motor full coil (higher torque) connections

Tel: +086 0755-26434369 5 Web Site: <u>www.leadshine.com</u> Tel: +086 0755-26434369 6 Web Site: <u>www.leadshine.com</u>



#### Connections to 8-lead Motors

8 lead motors offer a high degree of flexibility to the system designer in that they may be connected in series or parallel, thus satisfying a wide range of applications.

#### **Series Connections**

A series motor configuration would typically be used in applications where a higher torque at lower speeds is required. Because this configuration has the most inductance, the performance will start to degrade at higher speeds. In series mode, the motors should also be run at only 70% of their rated current to prevent over heating.



Figure 8: 8-lead motor series connections

#### **Parallel Connections**

An 8 lead motor in a parallel configuration offers a more stable, but lower torque at lower speeds. But because of the lower inductance, there will be higher torque at higher speeds. Multiply the per phase (or unipolar) current rating by 1.96, or the bipolar current rating by 1.4, to determine the peak output current.

 


Figure 9: 8-lead motor parallel connections

# 6. Power Supply Selection

The M880A can match medium and small size stepping motors (from NEMA frame size 17 to 43) made by Leadshine or other motor manufactures around the world. To achieve good driving performances, it is important to select supply voltage and output current properly. Generally speaking, supply voltage determines the high speed performance of the motor, while output current determines the output torque of the driven motor (particularly at lower speed). Higher supply voltage will allow higher motor speed to be achieved, at the price of more noise and heating. If the motion speed



requirement is low, it's better to use lower supply voltage to decrease noise, heating and improve reliability. Note: MEANWELL DRP-480S-48 (48VDC, 480Watt power supply) must be selected in order to make the whole system comply with UL standards for safety.

#### **Regulated or Unregulated Power Supply**

Both regulated and unregulated power supplies can be used to supply the Drive. However, unregulated power supplies are preferred due to their ability to withstand current surge. If regulated power supplies (such as most switching supplies.) are indeed used, it is important to have large current output rating to avoid problems like current clamp, for example using 4A supply for 3A motor-Drive operation. On the other hand, if unregulated supply is used, one may use a power supply of lower current rating than that of motor (typically 50% ~70% of motor current). The reason is that the Drive draws current from the power supply capacitor of the unregulated supply only during the ON duration of the PWM cycle, but not during the OFF duration. Therefore, the average current withdrawn from power supply is considerably less than motor current. For example, two 3A motors can be well supplied by one power supply of 4A rating.

#### **Multiple Drives**

 
It is recommended to have multiple Drives to share one power supply to reduce cost, if the supply has enough capacity. To avoid cross interference, **DO NOT** daisy-chain the power supply input pins of the Drives. (Instead, please connect them to power supply separately.)

# **Selecting Supply Voltage**

The power MOSFETS inside the M880A can actually operate within  $+24 \sim +80$ VDC, including power input fluctuation and back EMF voltage generated by motor coils during motor shaft deceleration. Higher supply voltage can increase motor torque at higher speeds, thus helpful for avoiding losing steps. However, higher voltage may cause bigger motor vibration at lower speed, and it may also cause over-voltage protection or even Drive damage. Therefore, it is suggested to choose only sufficiently high supply voltage for intended applications, and it is suggested to use power supplies with theoretical output voltage of  $+24 \sim +72$ VDC, leaving room for power fluctuation and back-EMF.

# 7. Selecting Microstep Resolution and Drive Output Current

This Drive uses an 8-bit DIP switch to set microstep resolution, and motor operating current, as shown below:



Tel: +086 0755-26434369 7 Web Site: www.leadshine.com Tel: +086 0755-26434369 8 Web Site: www.leadshine.com



#### **Microstep Resolution Selection**

Microstep resolution is set by SW5, 6, 7, 8 of the DIP switch as shown in the following table:

Microstep	Steps/rev.(for 1.8°motor)	SW5	SW6	SW7	SW8
2	400	ON	ON	ON	ON
4	800	OFF	ON	ON	ON
8	1600	ON	OFF	ON	ON
16	3200	OFF	OFF	ON	ON
32	6400	ON	ON	OFF	ON
64	12800	OFF	ON	OFF	ON
128	25600	ON	OFF	OFF	ON
256	51200	OFF	OFF	OFF	ON
5	1000	ON	ON	ON	OFF
10	2000	OFF	ON	ON	OFF
20	4000	ON	OFF	ON	OFF
25	5000	OFF	OFF	ON	OFF
40	8000	ON	ON	OFF	OFF
50	10000	OFF	ON	OFF	OFF
100	20000	ON	OFF	OFF	OFF
200	40000	OFF	OFF	OFF	OFF

# **Current Settings**

For a given motor, higher Drive current will make the motor to output more torque, but at the same time causes more heating in the motor and Drive. Therefore, output current is generally set to be such that the motor will not overheat for long time operation. Since parallel and serial connections of motor coils will significantly change resulting inductance and resistance, it is therefore important to set Drive output current depending on motor phase current, motor leads and connection methods. Phase current rating supplied by motor manufacturer is important in selecting Drive current, however the selection also depends on leads and connections.

The first three bits (SW1, 2, 3) of the DIP switch are used to set the dynamic current. Select a setting closest to your motor's required current.



#### **Dynamic current setting**

Peak Current	RMS Current	SW1	SW2	SW3
2.8 A	2.0 A	ON	ON	ON
3.5 A	2.5 A	OFF	ON	ON
4.2 A	3.0 A	ON	OFF	ON
4.9 A	3.5 A	OFF	OFF	ON
5.7 A	4.1 A	ON	ON	OFF
6.4 A	4.6 A	OFF	ON	OFF
7.0 A	5.0 A	ON	OFF	OFF
7.8 A	5.6 A	OFF	OFF	OFF

<u>Notes:</u> Due to motor inductance, the actual current in the coil may be smaller than the dynamic current setting, particularly under high speed condition.

#### Standstill current setting

SW4 is used for this purpose. OFF meaning that the standstill current is set to be half of the selected dynamic current, and ON meaning that standstill current is set to be the same as the selected dynamic current.

The current automatically reduced to 60% of the selected dynamic current one second after the last pulse. Theoretically, this will reduce motor heating to 36% (due to  $P=I^{2*}R$ ) of the original value. If the application needs a different standstill current, please contact Leadshine.

# 8. Wiring Notes

- In order to improve anti-interference performance of the Drive, it is recommended to use twisted pair shield cable.
- I To prevent noise incurred in PUL/DIR signal, pulse/direction signal wires and motor wires should not be tied up together. It is better to separate them by at least 10 cm, otherwise the disturbing signals generated by motor will easily disturb pulse direction signals, causing motor position error, system instability and other failures.
- If a power supply serves several Drives, separately connecting the Drives is recommended instead of daisy-chaining.
- It is prohibited to pull and plug connector P2 while the Drive is powered ON, because there is high current flowing through motor coils (even when motor is at standstill). Pulling or plugging connector P2 with power on will cause extremely high back-EMF voltage surge, which may damage the Drive.

Tel: +086 0755-26434369 9 Web Site: www.leadshine.com Tel: +086 0755-26434369 10 Web Site: www.leadshine.com

# 9. Typical Connection

A complete stepping system should include stepping motor, stepping Drive, power supply and controller (pulse generator). A typical connection is shown as figure 10.

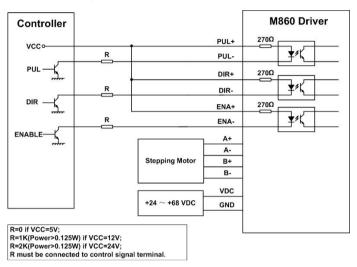


Figure 10: Typical connection

# 10. Sequence Chart of Control Signals

In order to avoid some fault operations and deviations, PUL, DIR and ENA should abide by some rules, shown as following diagram:

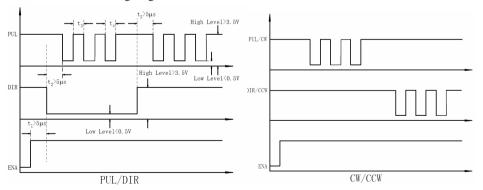


Figure 11: Sequence chart of control signals



#### Remark:

- a) t1: ENA must be ahead of DIR by at least 5μs. Usually, ENA+ and ENA- are NC (not connected). See "Connector P1 Configurations" for more information.
- b) t2: DIR must be ahead of PUL effective edge by 5µs to ensure correct direction;
- c) t3: Pulse width not less than 1.5µs;
- t4: Low level width not less than 1.5μs.

#### 11. Protection Functions

To improve reliability, the Drive incorporates some built-in protections features.

#### Short-voltage and Over-voltage protection

When power supply voltage is lower than +18VDC, over-voltage protection will be activated and power indicator LED will turn off. When power supply voltage exceeds +94VDC, over-voltage protection will be activated and the Alarm indicator LED will turn on.

#### **Over-current Protection**

Protection will be activated when continuous current reaches to 16A.

#### **Short Circuit Protection**

Protection will be activated in case of short circuit between motor coils or between motor coil and ground.

# 12. Frequently Asked Questions

In the event that your Drive doesn't operate properly, the first step is to identify whether the problem is electrical or mechanical in nature. The next step is to isolate the system component that is causing the problem. As part of this process you may have to disconnect the individual components that make up your system and verify that they operate independently. It is important to document each step in the troubleshooting process. You may need this documentation to refer back to at a later date, and these details will greatly assist our Technical Support staff in determining the problem should you need assistance.

Many of the problems that affect motion control systems can be traced to electrical noise, controller software errors, or mistake in wiring.

Tel: +086 0755-26434369 11 Web Site: www.leadshine.com Tel: +086 0755-26434369 12 Web Site: www.leadshine.com



#### **Problem Symptoms and Possible Causes**

Symptoms	Possible Problems		
	No power		
	Microstep resolution setting is wrong		
Motor is not rotating	DIP switch current setting is wrong		
	Fault condition exists		
	The Drive is disabled		
Motor rotates in the wrong direction	Motor phases may be connected in reverse		
The Drive in fault	DIP switch current setting is wrong		
The Drive in fault	Something wrong with motor coil		
	Control signal is too weak		
	Control signal is interfered		
Erratic motor motion	Wrong motor connection		
	Something wrong with motor coil		
	Current setting is too small, losing steps		
	Current setting is too small		
Motor stalls during acceleration	Motor is undersized for the application		
Motor stans during acceleration	Acceleration is set too high		
	Power supply voltage too low		
	Inadequate heat sinking / cooling		
Excessive motor and Drive heating	Automatic current reduction function not being utilized		
	Current is set too high		



#### **APPENDIX**

#### **Twelve Month Limited Warranty**

Leadshine Technology Co., Ltd. warrants its products against defects in materials and workmanship for a period of 12 months from shipment out of factory. During the warranty period, Leadshine will either, at its option, repair or replace products which proved to be defective.

#### **Exclusions**

The above warranty does not extend to any product damaged by reasons of improper or inadequate handlings by customer, improper or inadequate customer wirings, unauthorized modification or misuse, or operation beyond the electrical specifications of the product and/or operation beyond environmental specifications for the product.

# **Obtaining Warranty Service**

To obtain warranty service, a returned material authorization number (RMA) must be obtained from customer service at e-mail: <a href="mailto:tech@leadshine.com">tech@leadshine.com</a> before returning product for service. Customer shall prepay shipping charges for products returned to Leadshine for warranty service, and Leadshine shall pay for return of products to customer.

# **Warranty Limitations**

Leadshine makes no other warranty, either expressed or implied, with respect to the product. Leadshine specifically disclaims the implied warranties of merchantability and fitness for a particular purpose. Some jurisdictions do not allow limitations on how long and implied warranty lasts, so the above limitation or exclusion may not apply to you. However, any implied warranty of merchantability or fitness is limited to the 12-month duration of this written warranty.

# **Shipping Failed Product**

If your product fail during the warranty period, e-mail customer service at <a href="tech@leadshine.com">tech@leadshine.com</a> to obtain a returned material authorization number (RMA) before returning product for service. Please include a written description of the problem along with contact name and address. Send failed product to distributor in your area or: <a href="Leadshine Technology Co., Ltd. 3/F">Leadshine Technology Co., Ltd. 3/F</a>, <a href="Block 2">Block 2</a>, <a href="Nanyou Tianan Industrial Park">Nanshan Dist</a>, <a href="Shenzhen">Shenzhen</a>, <a href="China.">China</a>. Also enclose information regarding the circumstances prior to product failure.



#### **Contact Us**

# **China Headquarters**

Address: 3/F, Block 2, Nanyou Tianan Industrial Park, Nanshan District Shenzhen, China

Web: http://www.leadshine.com

#### Sales Hot Line:

Tel: 86-755-2643 4369 (for All)

86-755-2641-7674 (for Asia, Australia, Africa areas)

86-755-2640-9254 (for Europe, America areas)

Fax: 86-755-2640-2718

Email: sales@leadshine.com.

## **Technical Support:**

Tel: 86 755-2641-8447 and 86-755-2647-1129

Fax: 86-755-2640-2718

Email: tech@leadshine.com and vic@leadshine.com.

# **Leadshine Hong Kong**

Address: Rm 3, 9/F, Block E, Wah Lok Industrial Center, 31-41 Shan Mei St., Fo Tan,

Shatin, Hong Kong **Tel:** 852-2952-9114 **Fax:** 852-2952-9395

Email: hk sales@leadshine.com.

#### Leadshine U.S.A

Address: 25 Mauchly, Suite 318 Irvine, California 92618

**Tel:** 1-301-433-3780 **Fax:** 1-301-637-2718

Web: http://www.leadshineUSA.com

Email: usa sales@leadshine.com and cli@leadshine.com.